


BRAKE CHART 4 BRAKE NOISE DIAGNOSIS

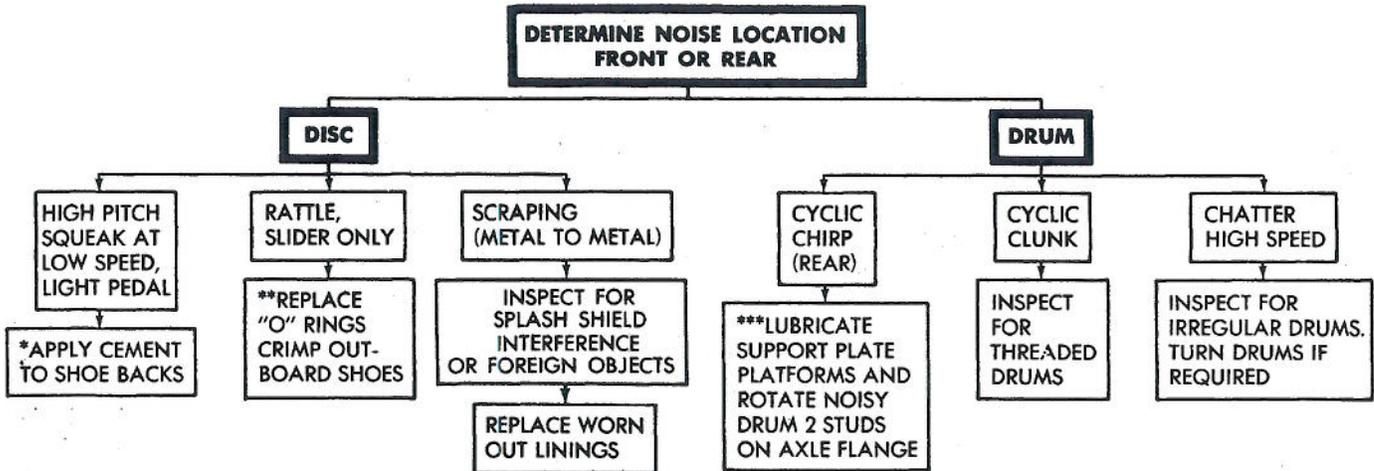


*APPLY MOPAR CEMENT PART NUMBER 3683897, OR EQUIVALENT, TO SHOE BACKS AND TO PISTON AND CALIPER FINGER CONTACT AREAS. REMOVE ALUMINUM GASKET IF SHOE IS SO EQUIPPED.

**INSTALL "O" RINGS (AROUND ADAPTER) BETWEEN MACHINED "WAYS" OF CALIPER AND ADAPTER.

***MOPAR MULTIPURPOSE LUBRICANT, PART NUMBER 2932524, OR EQUIVALENT.

PH633C

BRAKE CHART 5 WHEEL BRAKES DIAGNOSIS

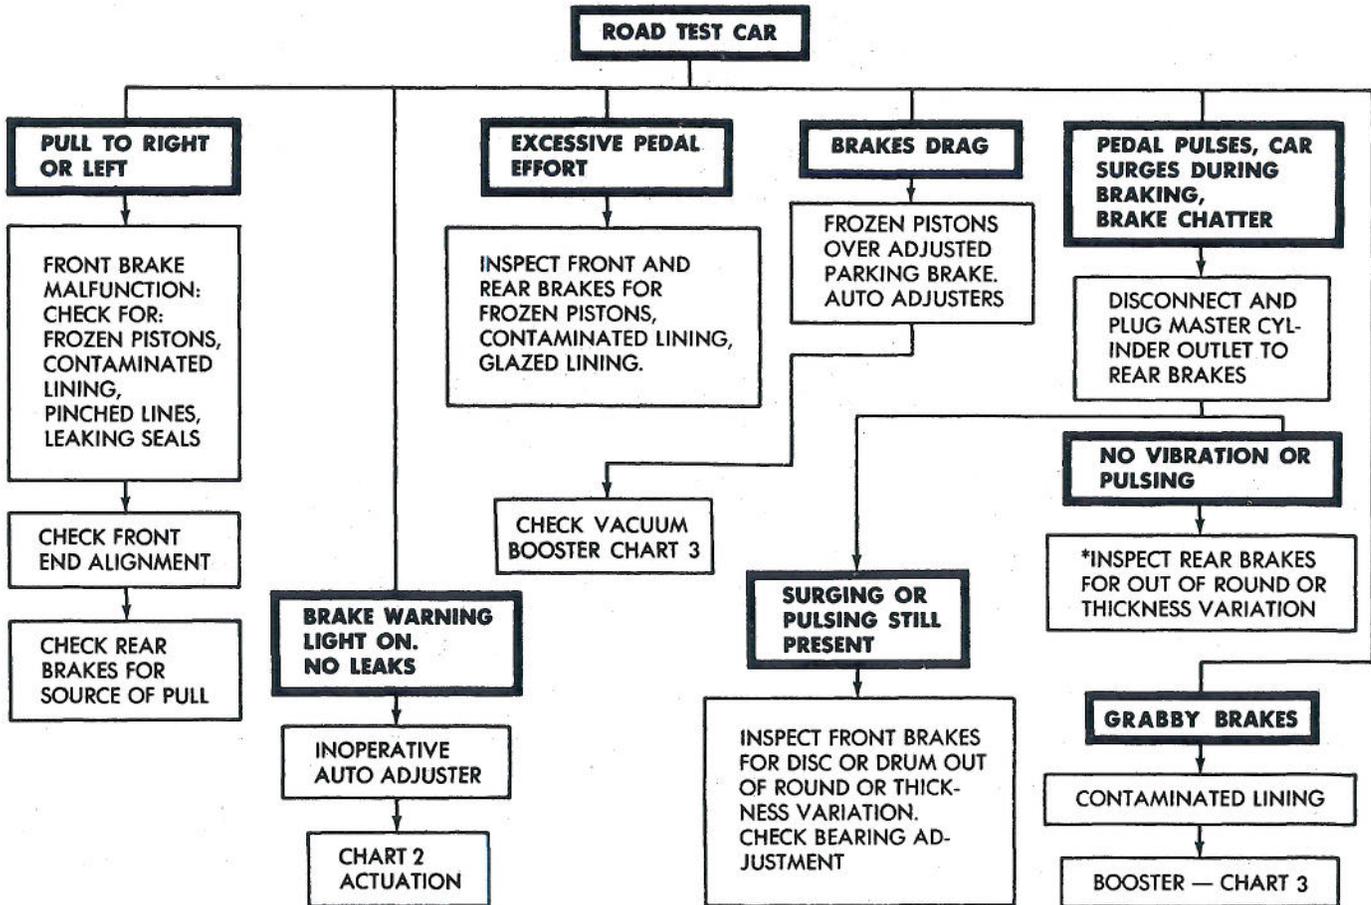

*PULSATION CAUSED BY REAR BRAKES MAY BE ELIMINATED OR REDUCED BY ROTATION DRUM (REAR) TWO STUDS ON AXLE FLANGE.

PH632C